

## **GENUINE PARTS**

# **INSTALLATION INSTRUCTIONS**


**DESCRIPTION:** Splash Guard Kit - Rear Set

**APPLICATION:** Altima

**PART NUMBER:** T99J2 6CAxx (xx Designates color)

#### **KIT CONTENTS:**

Item	Qty.	Part Description	Service Part Number
Α	1	Splash Guard - Rear Right	
В	1	Splash Guard - Rear Left	
С	1	Installation Instruction Replacement Template	999V2 AW000
D	1	Installation Hardware Kit	
Е	4	Phillips Screw M5 x 20mm	14-51 00891
F	4	Spring Nut M5	12-41 01011
G	2	• CLIP	15-53 05933

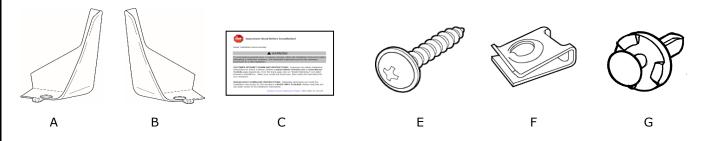

## **TOOLS REQUIRED:**


- Phillips head short screwdriver
- Clip removal tool
- Drill
- 6mm (1/4") drill bit

- Clean, lint-free wiping cloth
- Mild soap / water mixture
- 90% or greater alcohol


## PRE-INSTALLATION WARNINGS, CAUTIONS, CRITICAL STEPS, and NOTES:

- Dealer Installation Recommended. Instructions may refer to Service Manual.
- These instructions are for left side of vehicle; same procedure applies to right side.


## **INSTALLATION PROCEDURE:**

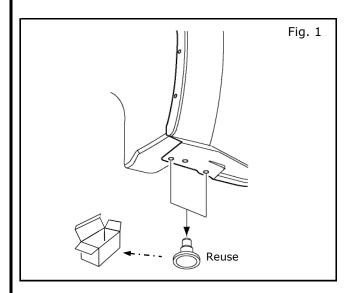

1) Remove clips from rear bumper and keep to reuse.

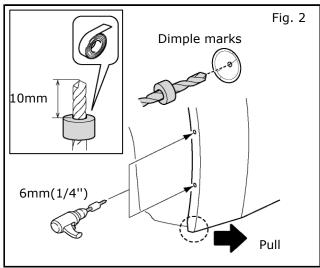


2) Pull out on bottom corner of rear bumper, and drill 6mm(1/4") holes at dimple locations.

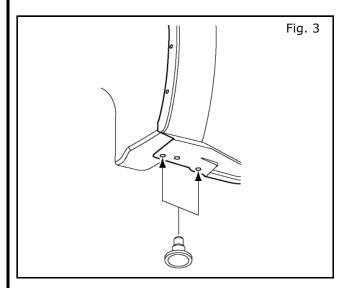


3) Reinstall clips.


## **INSTALLATION PROCEDURE:**

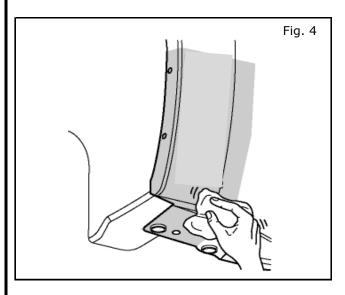

- 4) Clean installation surface (shaded area) with mild soap/water mixture.
- 5) Using a clean, lint free cloth, wipe tape area with 90% or greater alcohol.

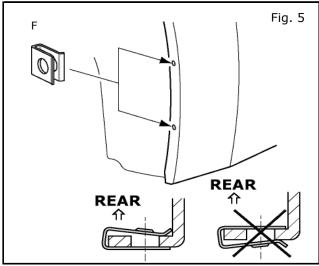


6) Install spring nuts(F).

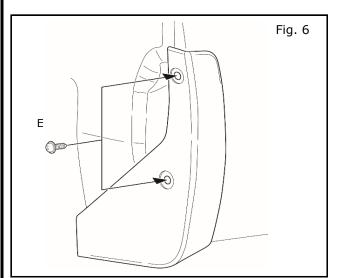


7) Align rear splash guard to vehicle and loosely install phillips screws(E).

#### **INSTALLATION PROCEDURE:**

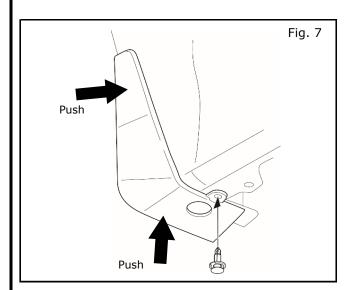

8) Push splash guard upward/inward and install clip(G).

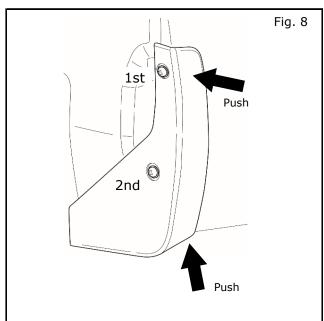

9) Push splash guard upward/inward, and tighten phillips screw(E) in sequence shown.

#### NOTE:

Do not over tighten screws. Reference tightening torque 3.8~4.4 N-m (33.6~38.9 lb-in).

#### **ACCESSORY CHECK:**

Check all torque val
----------------------

Clean rear bumper near installation areas of vehicle.

## **FINAL INSPECTION:**

Verify exterior is not damaged.